




IB Acrylic HT Top Coat - Acrylic Base Coat - Existing Roof - Granule Modified Bitumen

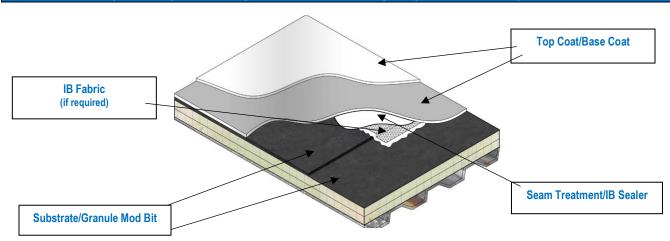

	Clean Roof	Seam Treatment	Base Coat	Reflective Coat
Product	10 minutes	® Sealer	18 maria	

HT-EX-MB						
Spec#	Step 1 Surface Preparation	Step 2 Seam Treatment	Step 3 Base Coat	Step 4 Reflective Coat*	Required Dry Mil	Warranty Length
	IB Roof Cleaner Concentrate (diluted 9:1)	IB Sealer	IB Bleed Block	IB Acrylic HT	Thickness	
HT-EX-MB-5	1 gal/150 sq. ft.	55 Wet Mils	1.25 gal/square	1.25 gal/square	22	5 year
HT-EX-MB-10	1 gal/150 sq. ft.	55 Wet Mils	1.5 gal/square	1.5 gal/square	26	10 year
HT-EX-MB-12	1 gal/150 sq. ft.	55 Wet Mils	1.75 gal/square	1.75 gal/square	31	12 year
HT-EX-MB-15	1 gal/150 sq. ft.	55 Wet Mils	2.0 gal/square	2.0 gal/square	35	15 year

*Acrylic HT coating may be applied in one (1) coat (single pass) up to 1.75 gal/square per pass. Where rate exceeds 1.75 gal/square, the coating shall be applied in two (2) coats (two passes).

For additional information about IB Roof Systems requirements, recommendations, installation details, approvals and limitations for the above assemblies, please refer to the latest edition of the IB Roof Systems Coating Specifications Manual. For Technical Services please contact us at 800-426-1626.

Note: Coverage rates may vary due to substrate porosity and/or irregularity of the roof surface.

Reflective Coating		Colors	Warranties
☐ IB Acrylic HT Coating (Reflective Coat)	□White □Tan	n □ Gray	□Warranty Plus □ Limited Material
Submitted By: Company: Email:		Project Name: Address:	